


Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

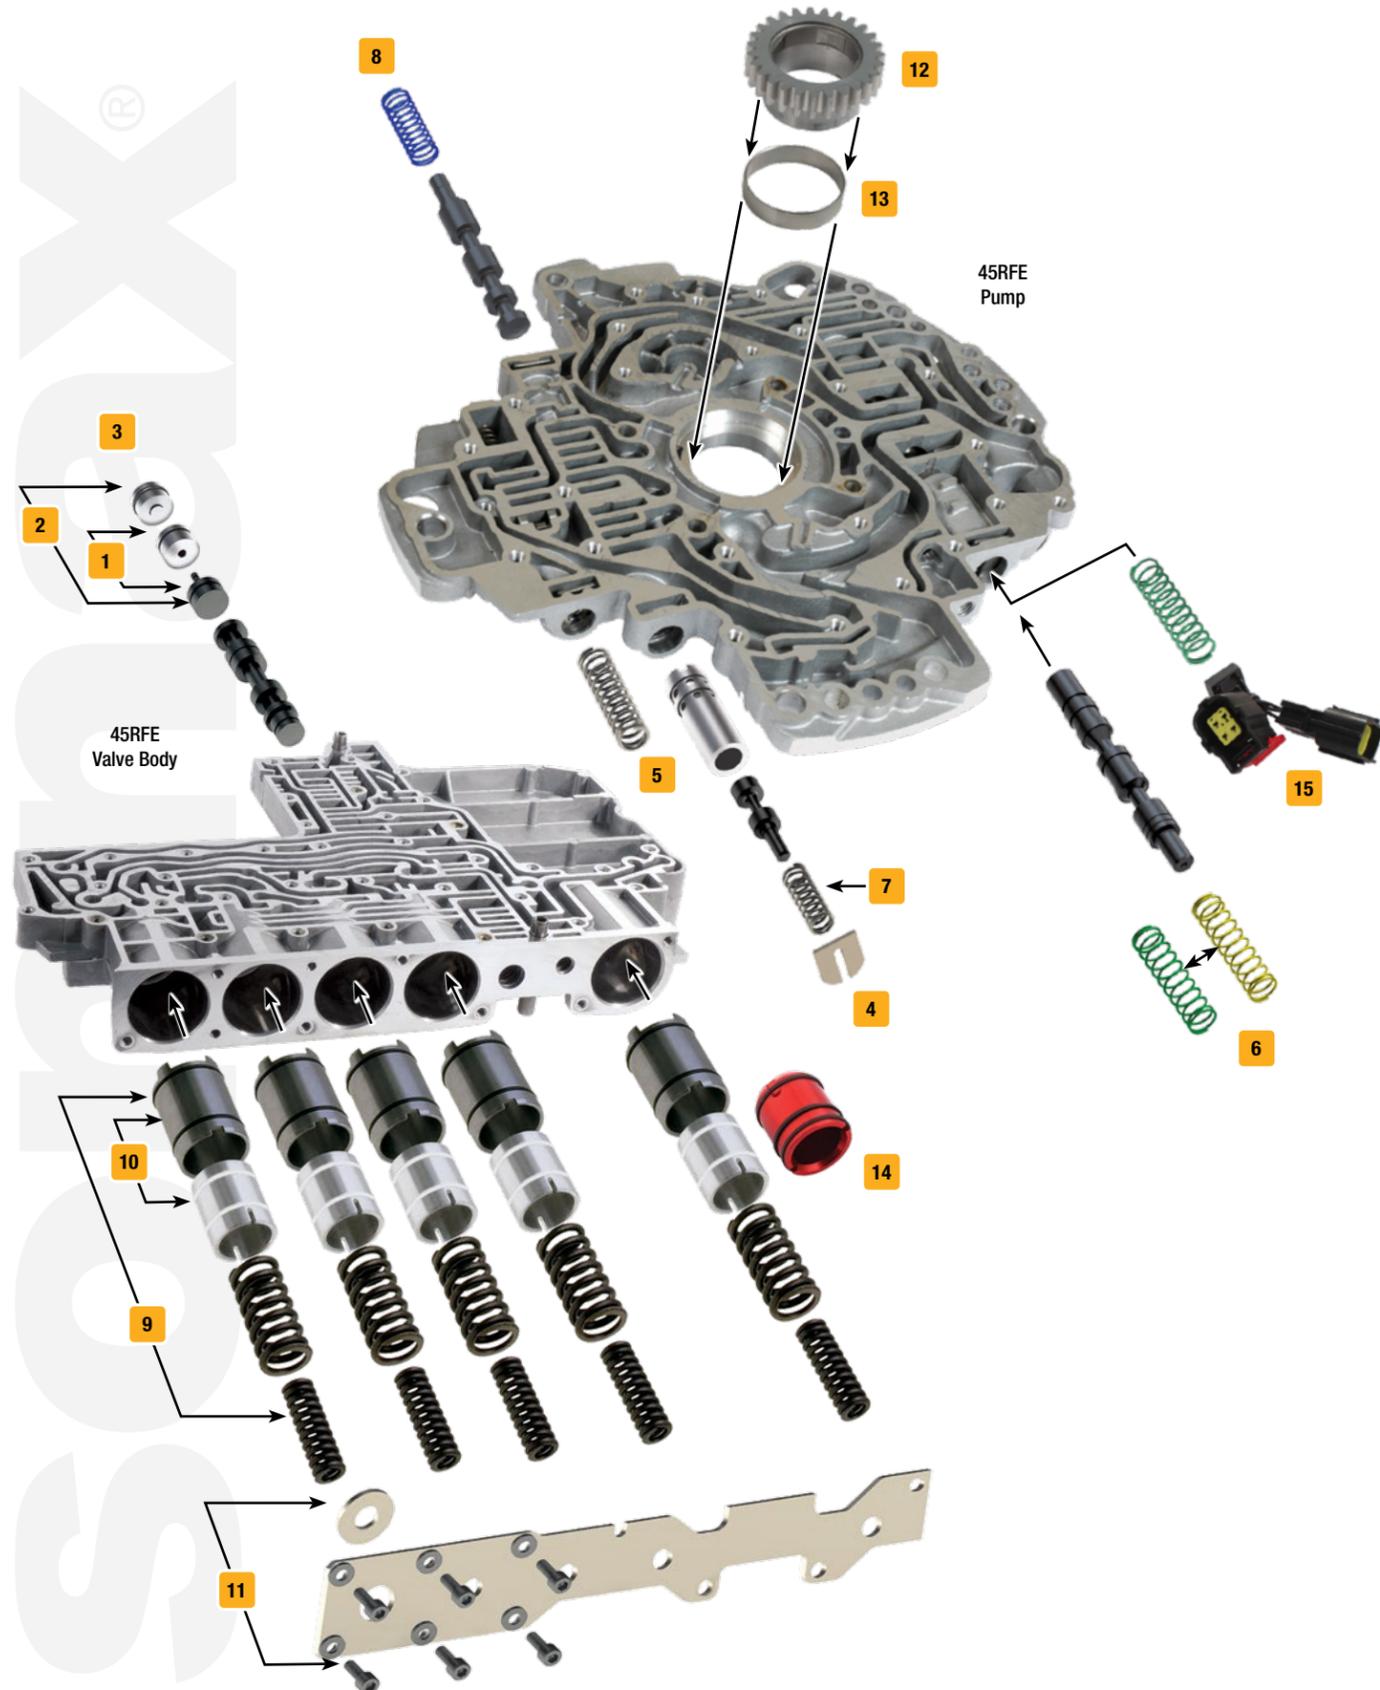

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
<b>TCC/Lockup Symptoms</b>				
Codes 841, 868, 871, 988, 1775, 1776, OD clutch burned, Failsafe mode, Bind-up	Solenoid Switch Valve Plug Kit	1 92835-02K	Fits bores containing OE switch valve w/ .420" dia. large spool only	
	Solenoid Switch Valve Plug Kit	1 92835-39K	Fits bores containing OE switch valve w/ .453" dia. large spool and I.D. groove	
	Oversized Solenoid Switch Valve Plug Kit	2 92835-22K	Fits bores containing OE switch valve w/ .453" dia. large spool only	92835-RM22
	Oversized Solenoid Switch Valve & Plug Kit	3 92835-32K	Fits bores containing OE switch valve w/ .420" dia. large spool only	F-92835-TL32*
	Oversized Solenoid Switch Valve & Plug Kit	3 92835-31K	Fits bores containing OE switch valve w/ .453" dia. large spool only	F-92835-TL31*
Delayed engagement, Loss of power, Engine stall, Low TCC release pressure, Low cooler flow	TC Limit Valve Kit	4 44912-03K		F-44912-TL*
Harsh TCC apply, TCC apply & release concerns	TCC Accumulator Spring	5 44912-01	5/Bag	
No lockup, Engine stall, TCC slip, Overheating, TCC codes, Loss of fuel economy	Oversized TCC Switch Valve Kit	6 44912-08K		F-44912-TL8*
Broken spring, Engine stall on engagement, Delayed engagement, Loss of power	Torque Converter Limit Spring	7 44912-02	Fits OE aluminum valves found in early-style units only, not for use with 44912-03K, 5/bag	
<b>Pressure Problems</b>				
Harsh shifts, Erratic line pressure, Broken parts due to excessive line pressure	Oversized Pressure Regulator Valve Kit	9 44912-10K		F-44912-TL10*
<b>Shift/Engagement Concerns</b>				
Slide shifts, High CVIs, 1-2 Shudder, Coastdown clunk	Accumulator Piston & Sleeve Kit	9 92834-05K	Fits 5 locations in 45RFE, 545RFE only, restores OE shift quality	
	Accumulator Piston & Sleeve Kit	10 92834-03K	Fits 5 locations in 45RFE, 545RFE only, firmer shift than OE	
<b>Component Damage/Failure</b>				
Damaged accumulator plate	Accumulator Cover Plate Kit	11 44892-01K		44892-TL
Pump gear wear or fracture, Noise concerns	Center Pump Gear	12 72530B-02	68RFE only	
	Center Pump Gear Bushing	13 72530B-03	68RFE only, precision	
<b>High Performance/Heavy Duty Upgrades</b>				
Prevents piston breakage & salvages worn bores	Accumulator Piston Kit	14 44894-01K	Billet aluminum w/ dual support seals	
	Accumulator Piston Kit	14 44894-01MK	Billet aluminum w/ dual support seals, includes 5 pistons	
Classic, large-ratio boost valve for crisp, clean shifts without harshness.	Line Pressure Booster Kit	15 RFE-LB1	Fits gas or diesel units, can be installed with or without spring in most RFE units	

\* VB-FIX Required